

Case 1 1
 AddInfo 1
 Cause 1
 Solution 1
Case 2 1
 AddInfo 1
 Cause 1
 Solution 1

ethercat, , homing, -21070, ,

Error : -21070

× -21070 (Homming Start Timeout)

Case 1

AddInfo

- (-) 가
- (-) (NOT)
- -21070 (Homming Start Timeout) 가

Cause

- POT 가 (+)

Solution

- POT OFF

Case 2

AddInfo

- 가 (HomeMode -10 ~ 99)
- , -21070 (Homming Start Timeout) 가
-

Cause

- SDO 0x6080 (Max motor speed) 0 ¹⁾

Solution

- SDO 0x6080 3000

<ul style="list-style-type: none">• ecmSxCfg_SetMaxSpdOfCT() ³⁾•	MaxSpd	3000	²⁾
--	--------	------	---------------

¹⁾

Omron 0x607F (Max Profile Speed)

²⁾

Omron 0x607F ecmSxCfg_SetMaxProfSpdOfCT()

³⁾

100

From:

<http://comizoa.com/info/> - -

Permanent link:

http://comizoa.com/info/doku.php?id=platform:ethercat:100_api:5_errorcode:21070&rev=1558503076

Last update: **2024/07/08 18:22**