

Case 1 ..... 1  
Case 2 ..... 1  
Case 3 ..... 1  
Case 4 ..... 1  
Case 5 ..... 2

# ErrorCode : -21070

× -21070 (Homming Start Timeout)  
가 가

**Case 1**

- Homing Method
- Homing Method
  - 
  - 0x60E3:1 - 30 (Supported Homing Methods)

**Case 2**

- PDO Map "Modes of Opeation"
- 

**Case 3**

- Homing Speed (0x6099), Homing Acceleration(0x609A) 0
- Homing Speed (0x6099) Homing Acceleration(0x609A)
- ecmHomeCfg\_SetSpeedPatt()

**Case 4**

- Max motor speed (0x6080) 0 <sup>1)</sup>
- 0x6080:0 0 ( 3000)
- ecmSxCfg\_SetMaxSpdOfCT() MaxSpd 3000 <sup>2)</sup>

### Case 5

- (-) 가
- (-) ( NOT )
- **POT** 가 (+)
- -21070 (Homming Start Timeout)
- POT .
- POT OFF

<sup>1)</sup>  
Omron 0x607F (Max Profile Speed)

<sup>2)</sup>  
Omron 0x607F ecmSxCfg\_SetMaxProfSpdOfCT()

From:  
<http://comizoa.com/info/> - -

Permanent link:  
[http://comizoa.com/info/doku.php?id=platform:ethercat:100\\_api:5\\_errorcode:21070&rev=1624430390](http://comizoa.com/info/doku.php?id=platform:ethercat:100_api:5_errorcode:21070&rev=1624430390)

Last update: **2024/07/08 18:22**