Case 1	1

2025/11/06 01:39 1/2 ErrorCode : -21070

ErrorCode: -21070

× -21070 (Homming Start Timeout) 가 가

Case 1

Homing Method

Homing Method

o 0x60E3:1 - 30 (Supported Homing Methods)

Case 2

• PDO Map "Modes of Opeation"

•

Case 3

- Homing Speed (0x6099), Homing Acceleration(0x609A) 0
- Homing Speed (0x6099) Homing Acceleration(0x609A)
- ecmHomeCfg_SetSpeedPatt()

Case 4

Max motor speed	(0x60)80)	0	1)			
• 0x6080:0	0	(3000)			2)
 ecmSxCfg_S 	etMax	SpdOfC	T()		MaxSpd	3000	2)

(-) カ
 (-) (NOT)
 POT カ (+)
 -21070 (Homming Start Timeout)
 POT ・
 POT OFF

Omron 0x607F (Max Profile Speed)
Omron 0x607F ecmSxCfg_SetMaxProfSpdOfCT()

From:

http://comizoa.com/info/ - -

Permanent link:

http://comizoa.com/info/doku.php?id=platform:ethercat:100_api:5_errorcode:21070&rev=1625047900

Last update: 2024/07/08 18:22